

Installation



Cable Preparation Details

N-200

N-201


N-202

N-203

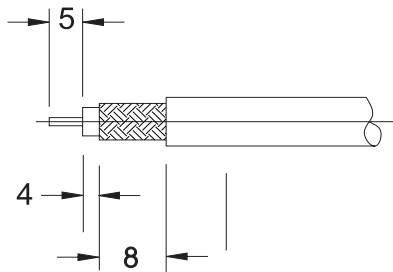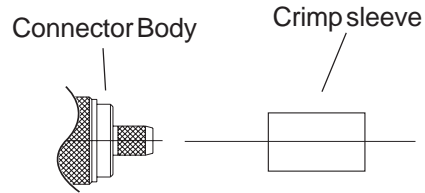


Cable Preparation

1. Straighten the end of the cable - 200mm.
2. Slide crimp sleeve onto cable
3. Strip jacket, braid and dielectric to dimensions shown (Do not attempt to remove aluminium foil)

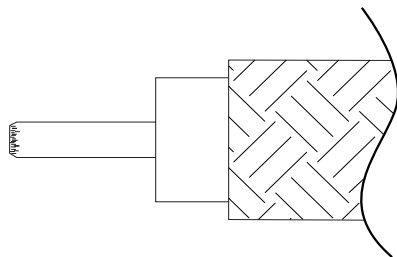

4. Chamfer the end of the centre conductor as shown.

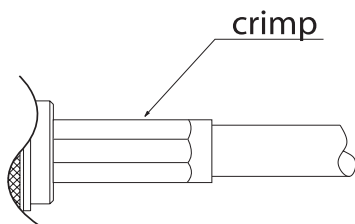

5. Slide cable into connector ensuring the tail of the connector slips over the aluminium sheild and under the braid sheild.
6. Crimp using C2CRT, RCT-214 or CTBC crimping tool.